

FR-S/BRZ/86 Tail Light Install Advisory

Please be advised that the installer must ensure the gaskets are aligned properly to create a watertight seal. Failure to do so may compromise the gaskets and allow water to enter the lights. Warranty does not cover improper installation of lights.

Ensure the gasket extends beyond the sealing surface by a minimum of 1/4 inch.

Image depicts improper gasket alignment. The circled edge does not have the required 1/4" extension past the sealing surface.

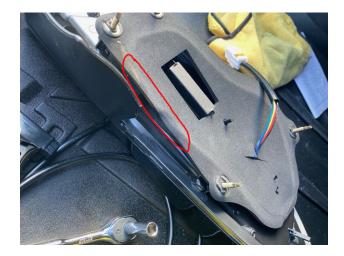


Image shows the edge of the sealing surface covered by the gasket. Ensure the gasket is not creased or pinched anywhere along the sealing surface edge.

Check the screws to ensure they are properly tightened to form a seal between the gasket and the sealing surface.

